

TECH NOTE 5

ISSUE DATE: 14-Dec-04
EXEDY REF: S
REVISED: 26-Jun-075

NISSAN RELEASE BEARING CLIP

Thrust bearing retainer clip installation where the clip is the type shown in the photographs.

It has been brought to our attention that after a new clutch kit has been fitted that contains bearing number BRG2227 or BRG2215, concerns have been encountered including bad shudder, fork may shake around and sometimes is severe enough that the whole vehicle shakes and vibrates.

It has been found the thrust bearing must be fitted with the upswept section of the bearing retainer clips facing towards the fork. If not orientated correctly; symptoms described above can be experienced.

**BRG2227 & BRG2215
UPSWEEP OF CLIP FACING AWAY
FROM FORK - INCORRECT**



**BRG2227 & BRG2215
UPSWEEP OF CLIP FACE
TOWARDS FORK - CORRECT**

