

TECH NOTE M

ISSUE DATE: 13-Dec-04
EXEDY REF: M
Revised: 04-May-07

TOYOTA OPTIMUM CLUTCH RELEASE


IMPORTANT

TO OBTAIN OPTIMUM CLUTCH RELEASE.


**DO NOT RELEASE VEHICLE TO DRIVER UNTIL
THE FOLLOWING PROCEDURES ARE FOLLOWED.**

After installation of this clutch, due to diaphragm position, the clutch master cylinder must be RESET as follows:

- A. Bleed System.
- B. **DO NOT** remove clevis pin on clutch master cylinder. Loosen push rod lock nut only.
- C. Screw adjustable push rod 1 to 1.5 turns into the yoke towards the clutch pedal (reducing displacement of fluid and travel) as per diagram.
- D. Relock lock nut.

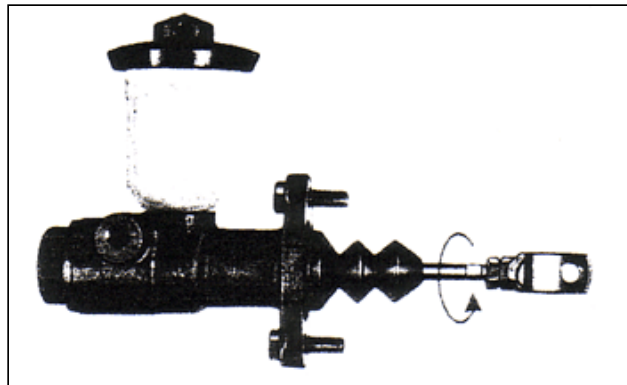

- E. Ensure the clutch engages approximately 25mm to 38mm from the floor as per diagram.

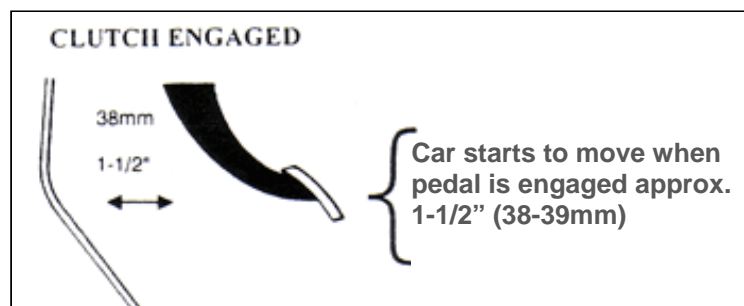

www.exedy.com.au

EXEDY
EXEDY AUSTRALIA PTY LTD